

RLC-3 Port Card not responding Modification

This modification is needed if a port card will not respond. This is most notable on ports above Port 5. The modification requires that a trace is cut and it is then buffered through a clock buffer circuit. The buffer circuit is U8.

1) Locate the drawing RLC3_1.PDF

This file shows the location of the trace modification and the buffer circuit.

- Cut the trace indicated
- Connect pin 11 of U8 to location 'A'
- Connect pin 8 of U8 to location 'B'
- Connect pins 9,10 together

2) Locate the drawing RLC3_A.PDF

This file shows the location of the 'A' connection point

3) Locate the drawing RLC3_B.PDF

This file shows the location of the 'B' connection point

Once the modification is complete, the radio card should work without installation concerns.

Good Luck!

Link Communications, Inc.
Technical Support

support@link-comm.com





